

# Unshielded Keystone Jack Termination Instructions


## Punch Down Termination

### Maxxam Products:


- XX60020 Cat 6 UTP Keystone Jack
- XX5E0018 Cat 5e UTP Keystone Jack



1. Remove approximately 50mm of the cable sheath and separate the 4 pairs. For Cat 6 cables, carefully cut back the central plastic separator flush with the cable sheath.

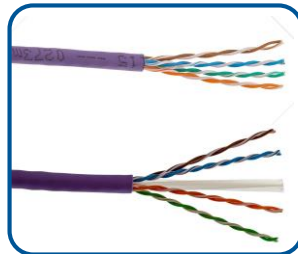

2. Present the cable at 90° to the rear of the jack and dress the wires in to the appropriate coloured IDC slots following the preferred wiring configuration.

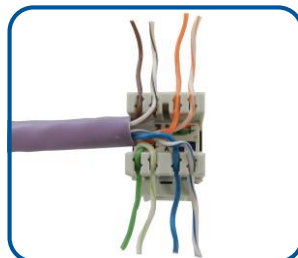

3. Insert the 'nose' of the jack in to aperture 'A' of the Maxxam Comfort Tool to support the jack. Punch down the wires using a 110 style termination tool.



4. Remove the jack from the Comfort Tool. Rotate the cable through 90° so that it is perpendicular to the jack and fit the wire retention cap.



5. Secure the cable to the strain relief flange using a cable tie, taking care not to over tighten it.

